

All COR ISO Recommendations

Latent Condition, Seismic and ISS

Wednesday, October 03, 2012 2:26:00 PM

Type	Rec #	ABU	Unit	Year (I/R)	LC or ISS Question #	LC Question ISS Question Seismic Area	Observation	Recommendation	Resolution	Duc Date	Assigned To	Status
Seismic	417	D&R	#5 RHENIFORMER	2006		R-550-580	Cracked fireproofing, picture 1.	Check behind fireproofing for corrosion and repair as needed	Fireproofing was removed, skirts inspected, corrosion noted. Skirt inspection results reviewed and determined by area Engineering as fit for continued service.	6/30/2007	Post, Ronald W.	Completed
Seismic	418	D&R	#5 RHENIFORMER	2006		E-560/570	Loose anchor bolt, pic 2.	Tighten nut or replace anchor bolt.	Work completed per Paul Reid. 7/6/07	6/30/2007	Post, Ronald W.	Completed
Seismic	419	D&R	#5 RHENIFORMER	2006		E-593	Part of knee brace cut out, pic 3	Reinforce or relocate and install new brace.	3" x 3" x 1/4" Angles were bolted onto each side of the existing beam with A-325 bolts, nuts, and washers. This will stengthen and reinforce the existing beam. (For details see EWO-2491)	6/30/2007	Post, Ronald W.	Completed